


MONUMENT RECORD

Corner ID: **CICr_F08**

South-West 1/16 Corner



Section 08- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

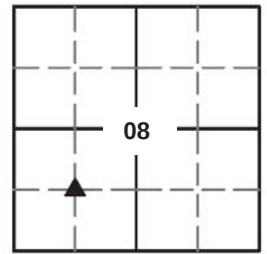

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)
0.4' x 0.6' limestone with cut "+" found 0.1' below grade

MONUMENT LOCATION SKETCH:

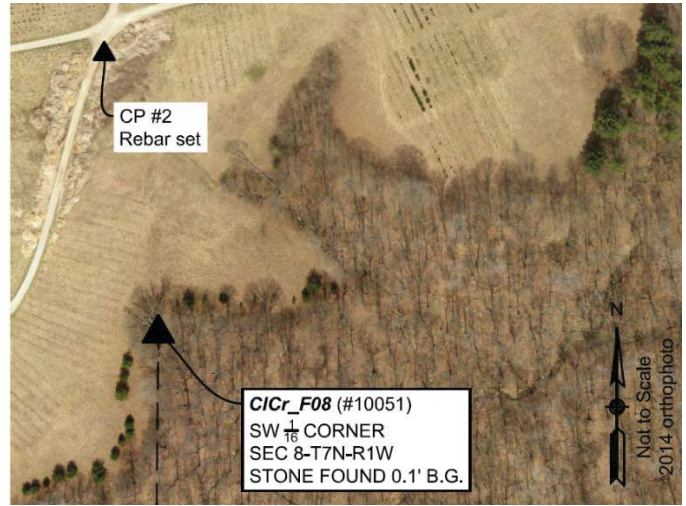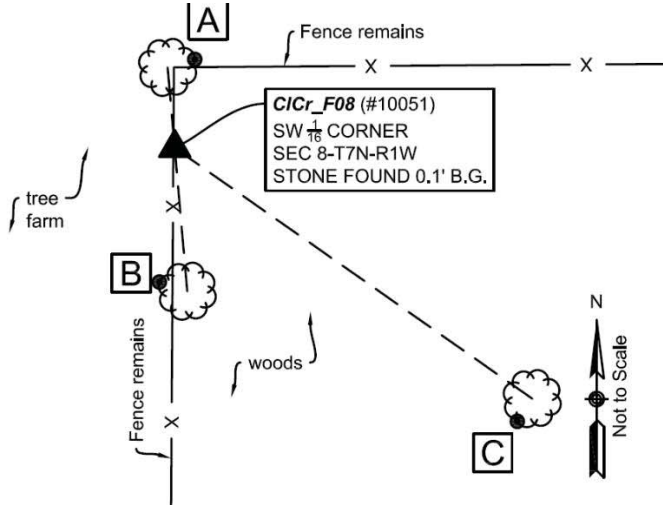

WITNESS MONUMENT TIES: Describe at least three new BT's and/or witness objects established or work done to preserve existing evidence. All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail. Distances to witness ties were measured with a Leica Disto laser distance meter. Bearings were collected with the internal magnetic compass of the Javad Triumph LS and were automatically adjusted to grid north.

ID	Bearing	Distance	Description
A	N 5° W	7.2'	Mag nail (no hack or washer) set 0.5' above grade in the east root of a 43.5" white oak with fence remains to the south and east.
B	S 5° E	12.8'	Mag nail and washer set in hack 1.1' above grade on the northwest side of a 24" shag bark hickory (looks very similar to a maple)
C	S 55° E	38.9'	Mag nail and washer set in hack 0.8' a.g. on the southwest side of a 21" red oak

PHOTO IDENTIFIED: Photo Date: 12/3/2018



Photo Orientation & Description: CICr_F08



Photo Orientation & Description: Looking north at CICr_F08



MONUMENT RECORD

Corner ID: **CICr_F08**

South-West 1/16 Corner

Section 08- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

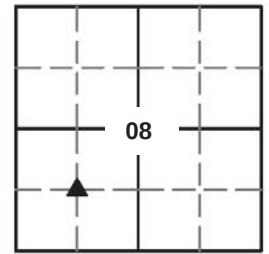


Photo Orientation & Description: Looking south at CICr_F08



Photo Orientation & Description: Looking west at CICr_F08

FIELD PERSONNEL:

Field Date: 12/03/2018 & 2/15/2019 By: R.Oser & C.Raley Project #: T07NR01W08 Field Book: 52, pgs. 66 & 79 Notes:

EXISTING SURVEY HISTORY

Include as much detail and history of the corner as known at the time of perpetuation

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: Not an original government corner By:

Where filed or recorded:

Original monument:

Bearing Trees or Reference Monuments:

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: No legal survey records found By:

Where filed or recorded:

Original monument:

Bearing Trees or Reference Monuments:

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND:

Include, search area or areas, search procedure, etc.

Date of Search: 12/3/2018 By: R.Oser & C.Raley Monument Found: stone BTs or Reference Objects Found: none Notes:

OTHER SURVEY HISTORY:

Include details such as surveyor name, date, recording info, monument description, etc.

This stone was accepted by Lee Utt on his 8/5/1983 survey in Sections 7 and 8-T7N-R1W for Ora Shields, on file as Reference Survey ID001110.

OTHER EVIDENCE:

Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.

The stone was found firmly planted at the base of a huge white oak. There were north and south fence remains in the ground over the stone. There is a huge white oak tree approximately 7 feet north of the stone with distinct fence remains to the south and east. The stone is surrounded by mowed fields to the north and west and mature woods to the southeast.

MONUMENT PRESERVATION:

Describe work done to preserve existing monument.

A 1-1/4" o.d. iron pipe was found 1.7' above grade on the south (long) side of the stone. We set a 5-foot t-post 0.5' east of the stone with a Monroe County "PROTECT NEARBY SURVEY MARKER" sign attached 2.7' above grade facing west. We tested the stone with hydrochloric acid to confirm the presence of carbonate minerals and we spray painted it orange.

THEORY OF LOCATION:

Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.

The origin of this stone is unknown. It was accepted as the best evidence of the corner with no associated uncertainty.

GEODETIC COORDINATES:

Northing: 1386201', Easting: 3104406'

BASIS OF GEODETIC COORDINATES: The basis of bearings is Grid North System NAD83 (2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b_conus.db3, US Survey Feet. Tied to NSRS using the JAVAD GNSS Data Online Processing Service (DPOS) to post-process static observations collected with a Javad Triumph 2 base. Positional values of this corner were determined from static GNSS and RTK GNSS (Javad Triumph LS Rover) observation.

This document is not complete without the associated Corner Perpetuation plat and report of survey for Section 08-T07N-R01W by Rachel Oser of the Monroe County Surveyor's Office dated April 15, 2019 and recorded as Instrument Number 2019004835 in the




MONUMENT RECORD

Corner ID: **CICr_F08**

South-West 1/16 Corner

Section 08- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

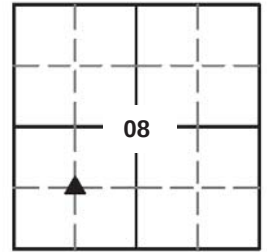

office of the Monroe County Recorder.

CERTIFICATIONS:



Rachel Oser

Date: 4/16/2019
Rachel Oser, State of Indiana
Professional Surveyor
No.21100022



Trohn Enright-Randolph

Date: 4/16/2019
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review
Board on 4/16/2019

